



Meridian Jet Center

Repair Station No. IMJR053F, EASA.145.5505
485 Industrial Ave
Teterboro, NJ 07608
Pho [REDACTED]
Fax [REDACTED]
Date: 11/8/2012, 2:32 PM

CUSTOMER INFORMATION
Hyperion Air, Inc Larry Morrison 3800 Southern Blvd. Suite 204 West Palm Beach, FL 33406 [REDACTED] Reg. No: N909JE Gulfstream G1159B Current A/C TT: 10870.4, A/C Landings: 5690 Hobbs: 10870.4 A/C Serial: 151 Terms: DIRECT BILL

Customer Invoice Work Order: 121012
--

Item: 1 - Inspection Item

Discrepancy	Hours	Subtotal
C/W THE FOLLOWING INSPECTION/SERVICING ITEMS: 200001- OPERATION NO. 1;	N/C	0.00
TRACKING ONLY.		

Corrective Action
C/W THE FOLLOWING INSPECTION/SERVICING ITEMS:
200001- OPERATION NO. 1;

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
6	EA	AC251B1/2 BLK 6OZ	SEALANT 6OZ (SAME AS PR1425) (P/O: CTR-10364)		55.55	333.30
2		MS24665-164	COTTER PIN		0.20	0.40
100		MS24694S53	SCREW (P/O: STK-10343)		0.20	20.00
100		MS24694S54	SCREW (P/O: STK-10343)		0.20	20.00
300		MS24694S55	SCREWS (P/O: STK-10343)		0.15	45.00
60	EA	NAS517-4-13	BOLT (P/O: TRN-10389) (Ship: 5.40)		0.88	52.80
75		NAS517-4-9	BOLT (P/O: TRN-10389) (Ship: 5.25)		0.40	30.00
1		PG310AGGEL	SEALANT REMOVER		125.00	125.00
2		PR1422A2PT	SEALANT: FUEL TANK,A/B,PT, PROSEAL 1422 (P/O: TRN-10424) (Ship: 7.04)		92.00	184.00
6	EA	PR1440-B-1/2 (6 oz)	SEALANT (P/O: TRN-10421)		45.25	271.50

Labor: \$0.00	Parts: \$1,082.00	Shipping: \$17.69	Item Subtotal: \$1,099.69
----------------------	--------------------------	--------------------------	----------------------------------

Item: 2 - Recommended Airframe

Discrepancy	Hours	Subtotal
211535- WATER SEPARATOR BAG- SERVICE;	Flat	275.00
Corrective Action 211535- WATER SEPARATOR BAG- SERVICE;		

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1		MS28775-242	PACKING		1.20	1.20

Labor: \$275.00	Parts: \$1.20	Shipping: \$0.00	Item Subtotal: \$276.20
------------------------	----------------------	-------------------------	--------------------------------

Item: 3 - Inspection Item

Discrepancy	Hours	Subtotal
212015- CABIN PRESSURE CONTROLLER- OPERATIONAL TEST;	Flat	220.00
Corrective Action 212015- CABIN PRESSURE CONTROLLER- OPERATIONAL TEST;		

Labor: \$220.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$220.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 4 - Inspection Item

Discrepancy	Hours	Subtotal
212510- EMER PRESSURE VALVE- OPERATIONAL TEST;	Flat	220.00
Corrective Action		
212510- EMER PRESSURE VALVE- OPERATIONAL TEST;		

Labor: \$220.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$220.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 5 - Inspection Item

Discrepancy	Hours	Subtotal
216027- PRESSURIZATION VALVE- INSPECTION;	Flat	1,100.00
216028- PRESSURIZATION SAFETY VALVE- GROUND TEST;		
Corrective Action		
216027- PRESSURIZATION VALVE- INSPECTION;		
216028- PRESSURIZATION SAFETY VALVE- GROUND TEST;		

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1		139495-1	FILTER (P/O: CTR-4792)		63.00	63.00

Labor: \$1,100.00	Parts: \$63.00	Shipping: \$0.00	Item Subtotal: \$1,163.00
--------------------------	-----------------------	-------------------------	----------------------------------

Item: 6 - Inspection Item

Discrepancy	Hours	Subtotal
216037- CABIN PRESSURE WARNING SYSTEM- FUNCTIONAL TEST;	Flat	110.00
Corrective Action		
216037- CABIN PRESSURE WARNING SYSTEM- FUNCTIONAL TEST;		

Labor: \$110.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$110.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 7 - Inspection Item

Discrepancy	Hours	Subtotal
221006/07/08- AUTOPILOT SYSTEM COMPUTER- SELF TEST- PITCH/ROLL/STAB AUG (SP-50);	Flat	330.00
Corrective Action		
221006/07/08- AUTOPILOT SYSTEM COMPUTER- SELF TEST- PITCH/ROLL/STAB AUG (SP-50);		

Labor: \$330.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$330.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 8 - Inspection Item

Discrepancy	Hours	Subtotal
231549- COCKPIT VOICE RECORDER SYSTEM- GROUND TEST;	Flat	550.00
232102/03/06- CVR UNDERWATER LOCATOR BEACON- BATTERY VOLTAGE/FUNCTIONAL TEST/SWITCH CLEAN;		
Corrective Action		
231549- COCKPIT VOICE RECORDER SYSTEM- GROUND TEST;		
232102, 232103, 232106 - CVR UNDERWATER LOCATOR BEACON - BATTERY VOLTAGE, FUNCTIONAL TEST, SWITCH CLEANING.		

Labor: \$550.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$550.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 9 - Inspection Item

Discrepancy	Hours	Subtotal
234555/60- LEFT/RIGHT STATIC DISCHARGE WICK- RESISTANCE CHECK;	Flat	440.00
234565/70- LEFT/RIGHT HORIZ STAB STATIC DISCHARGE WICKS- RESISTANCE CHECK;		
234575- TAIL CONE STATIC DISCHARGE WICK- RESISTANCE CHECK;		
234580- VERT STAB STATIC DISCHARGE WICKS- RESISTANCE CHECK;		

Corrective Action

234555/60- LEFT/RIGHT STATIC DISCHARGE WICK- RESISTANCE CHECK;
234565/70- LEFT/RIGHT HORIZ STAB STATIC DISCHARGE WICKS- RESISTANCE CHECK;
234575- TAIL CONE STATIC DISCHARGE WICK- RESISTANCE CHECK;
234580- VERT STAB STATIC DISCHARGE WICKS- RESISTANCE CHECK;

Labor: \$440.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$440.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 10 - Inspection Item

Discrepancy	Hours	Subtotal
240025- MASTER WARNING/AUX MASTER WARNING POWER CB LIGHT- COMPLETE CHECK;	Flat	330.00
240310- DC DISTRIBUTION SYSTEM- OPERATIONAL TEST;		

Corrective Action

240025- MASTER WARNING/AUX MASTER WARNING POWER CB LIGHT- COMPLETE CHECK;
240310- DC DISTRIBUTION SYSTEM- OPERATIONAL TEST;

Labor: \$330.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$330.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 11 - Inspection Item

Discrepancy	Hours	Subtotal
247646- BATTERY CIRCULATOR FAN- OPERATIONAL TEST;	Flat	165.00

Corrective Action

247646- BATTERY CIRCULATOR FAN- OPERATIONAL TEST;

Labor: \$165.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$165.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 12 - Inspection Item

Discrepancy	Hours	Subtotal
251023/33- PILOT/COPILOT INERTIA REEL - OPERATIONAL TEST;	Flat	55.00

Corrective Action

251023, 251033 - PILOT / COPILOT INERTIA REEL OPERATIONAL TEST.

Labor: \$55.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$55.00
-----------------------	----------------------	-------------------------	-------------------------------

Item: 13 - Inspection Item

Discrepancy	Hours	Subtotal
261015- FIRE PULL T HANDLE- OPERATIONAL TEST;	Flat	990.00
261020/25- FIRE EXTINGUISHER SYSTEM (LEFT/RIGHT ENGINE)- FUNCTIONAL TEST;		
261030- FIRE EXTINGUISHER SYSTEM (APU)- FUNCTIONAL TEST;		
261520- FIRE BOTTLE (APU)- WEIGHT CHECK;		

Corrective Action

261015- FIRE PULL T HANDLE- OPERATIONAL TEST;
261020/25- FIRE EXTINGUISHER SYSTEM (LEFT/RIGHT ENGINE)- FUNCTIONAL TEST;
261030- FIRE EXTINGUISHER SYSTEM (APU)- FUNCTIONAL TEST;
261520- FIRE BOTTLE (APU)- WEIGHT CHECK;

Labor: \$990.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$990.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 14 - Inspection Item

Discrepancy	Hours	Subtotal
264010- APU OVERHEAT SWITCH- TRIP POINT CHECK;	Flat	2,530.00
264615/16- ENGINE GENERATOR/ALTERNATOR (LEFT)- TRIP POINT CHECK;		
264617/18- ENGINE GENERATOR/ALTERNATOR (LEFT)- TRIP POINT CHECK;		
265020/25- BLEED AIR OVERHEAT SWITCH (LEFT/RIGHT)- TRIP POINT CHECK;		
268651/56- COMBINED/FLIGHT HYDRAULIC SYSTEM OVERHEAT SWITCH- TRIP POINT CHECK;		

Corrective Action

264010- APU OVERHEAT SWITCH- TRIP POINT CHECK;
 264615/16- ENGINE GENERATOR/ALTERNATOR (LEFT)- TRIP POINT CHECK;
 264617/18- ENGINE GENERATOR/ALTERNATOR (LEFT)- TRIP POINT CHECK;
 265020/25- BLEED AIR OVERHEAT SWITCH (LEFT/RIGHT)- TRIP POINT CHECK;
 268651/56- COMBINED/FLIGHT HYDRAULIC SYSTEM OVERHEAT SWITCH- TRIP POINT CHECK;

Labor: \$2,530.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$2,530.00
--------------------------	----------------------	-------------------------	----------------------------------

Item: 15 - Inspection Item

Discrepancy	Hours	Subtotal
270105- FLIGHT CONTROL MANUAL SHUTOFF VALVE- OPERATIONAL TEST;	Flat	1,705.00
270126- GROUND SPOILER FAULT DETECTION SYSTEM- FUNCTIONAL TEST;		
270150- GROUND SPOILER SYSTEM- OPERATIONAL TEST;		
270516- ANGLE OF ATTACK SYSTEM- OPERATIONAL TEST;		

Corrective Action

270105- FLIGHT CONTROL MANUAL SHUTOFF VALVE- OPERATIONAL TEST;
 270150- GROUND SPOILER SYSTEM- OPERATIONAL TEST;
 270150- GROUND SPOILER SYSTEM- OPERATIONAL TEST;
 270516- ANGLE OF ATTACK SYSTEM- OPERATIONAL TEST;

Labor: \$1,705.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$1,705.00
--------------------------	----------------------	-------------------------	----------------------------------

Item: 16 - Recommended Airframe

Discrepancy	Hours	Subtotal
270620/25- LEFT/RIGHT FLAP- LUBRICATION;	Flat	220.00
270621/26- LEFT/RIGHT FLAP TRAVEL NUT- LUBRICATION;		

Corrective Action

270620/25- LEFT/RIGHT FLAP- LUBRICATION;
 270621/26- LEFT/RIGHT FLAP TRAVEL NUT- LUBRICATION;

Labor: \$220.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$220.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 17 - Recommended Airframe

Discrepancy	Hours	Subtotal
270629- STALL BARRIER ACTUATOR- LUBRICATION;	Flat	330.00
270630- RUDDER TORQUE TUBE- LUBRICATION;		
270730/31- LEFT/RIGHT SPOILER RELIEF BUNGEE- LUBRICATION;		
270735/36- LEFT/RIGHT AILERON LOAD RELIEF BUNGEE- LUBRICATION;		
271025- ELEVATOR LOAD RELIEF BUNGEE- LUBRICATION;		
271321- RUDDER BUNGEE- LUBRICATION;		

Corrective Action

270629- STALL BARRIER ACTUATOR- LUBRICATION;
 270730/31- LEFT/RIGHT SPOILER RELIEF BUNGEE- LUBRICATION;
 270735/36- LEFT/RIGHT AILERON LOAD RELIEF BUNGEE- LUBRICATION;
 271025- ELEVATOR LOAD RELIEF BUNGEE- LUBRICATION;
 271321- RUDDER BUNGEE- LUBRICATION;
 270630 RUDDER TORQUE TUBE BEARING-LUBRICATION.

Labor: \$330.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$330.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 18 - Inspection Item

Discrepancy	Hours	Subtotal
280515- APU FUEL SHUTOFF VALVE (WING)- FUNCTIONAL TEST;	Flat	165.00
Corrective Action		
280515- APU FUEL SHUTOFF VALVE (WING)- FUNCTIONAL TEST;		

Labor: \$165.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$165.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 19 - Recommended Airframe

Discrepancy	Hours	Subtotal
301016/17- LEFT/RIGHT WINDSHIELD WIPER MOTOR - SHAFT LUBRICATION;	Flat	110.00
Corrective Action		
301016/17- LEFT/RIGHT WINDSHIELD WIPER MOTOR - SHAFT LUBRICATION;		

Labor: \$110.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$110.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 20 - Inspection Item

Discrepancy	Hours	Subtotal
301020/25- LEFT/RIGHT WING ANTI-ICE (LEFT/RIGHT)- OPERATIONAL TEST;	Flat	660.00
30103035/40- PROBE HEAT (AOA/PITOT/EPR)- OPERATIONAL TEST;		
Corrective Action		
301020/25- LEFT/RIGHT WING ANTI-ICE (LEFT/RIGHT)- OPERATIONAL TEST;		
301030/35/40- PROBE HEAT (AOA/PITOT/EPR)- OPERATIONAL TEST;		

Labor: \$660.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$660.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 21 - Recommended Airframe

Discrepancy	Hours	Subtotal
320630- NOSE GEAR- LUBRICATION;	Flat	2,805.00
320820- NOSE GEAR SHOCK STRUT- SERVICE;		
321015/25/26- NOSE GEAR STRUT FRICTION CHECK/STRUT CORROSION PREVENTION/ AXLE CORROSION PROTECTION;		
Corrective Action		
320630- NOSE GEAR- LUBRICATION;		
320820- NOSE GEAR SHOCK STRUT- SERVICE;		
321015/25/26- NOSE GEAR STRUT FRICTION CHECK/STRUT CORROSION PREVENTION/ AXLE CORROSION PROTECTION;		

Labor: \$2,805.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$2,805.00
--------------------------	----------------------	-------------------------	----------------------------------

Item: 22 - Inspection Item

Discrepancy	Hours	Subtotal
321320/25- LEFT/RIGHT MAIN GEAR SIDE BRACE FITTING PIN (LEFT/RIGHT)- INSPECTION;	Flat	935.00
322526- NOSE LANDING GEAR BUNGEE- LUBRICATION;		
323811/12- MAIN LANDING GEAR SEQUENCING BUNGEE (LEFT/RIGHT)- LUBRICATION;		
324012/5025- MAIN LANDING GEAR TIMER STRIKER ARM- INSPECTION;		
Corrective Action		
321320/25- LEFT/RIGHT MAIN GEAR SIDE BRACE FITTING PIN (LEFT/RIGHT)- INSPECTION;		
322526- NOSE LANDING GEAR BUNGEE- LUBRICATION;		
323811/12- MAIN LANDING GEAR SEQUENCING BUNGEE (LEFT/RIGHT)- LUBRICATION;		
324012/5025- MAIN LANDING GEAR TIMER STRIKER ARM- INSPECTION;		

Labor: \$935.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$935.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 23 - Inspection Item

Discrepancy	Hours	Subtotal
330200- EMERGENCY EXIT LIGHT BATTERY- SCRAP;	Flat	220.00
330210- EMERGENCY EXIT LIGHTS- OPERATIONAL TEST;		
330215- EXTERIOR LIGHTS- OPERATIONAL TEST;		
331530- LEFT AND RIGHT LANDING LIGHTS- LUBRICATION;		

Corrective Action

330200- EMERGENCY EXIT LIGHT BATTERY- SCRAP, INSTALLED 2 NEW D-CELLS;
 330210- EMERGENCY EXIT LIGHTS- OPERATIONAL TEST;
 330215- EXTERIOR LIGHTS- OPERATIONAL TEST;
 331530- LEFT AND RIGHT LANDING LIGHTS- LUBRICATION;

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
2	EA	D-CELL	BATTERY (P/O: STK-3790)		2.30	4.60

Labor: \$220.00	Parts: \$4.60	Shipping: \$0.00	Item Subtotal: \$224.60
------------------------	----------------------	-------------------------	--------------------------------

Item: 24 - Inspection Item

Discrepancy	Hours	Subtotal
341505/06- COMPASS SWING NO1/NO2;	Flat	660.00
348026/29- NO1 INU BATTERY- SERVICE/DEEP CYCLE;		

Corrective Action

341505/06- COMPASS SWING NO1/NO2;
 348026/348029- NO1 IRS BATTERY- SERVICE/DEEP CYCLE; BATTERY P/N CA-54-1, S/N 7908244
 WAS DEEP CYCLED AND TESTED BY FLIGHTPATH, CRS JG1R243K UNDER WO 132459 AND
 REINSTALLED.
 Outside Repair:
 FlightPath Services, Inc. - Invoice #IN0186798, Labor: 226.80, Parts: 0.00
 (CAP CHECK AND DEEP CYCLE)

Labor: \$886.80	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$886.80
------------------------	----------------------	-------------------------	--------------------------------

Item: 25 - Inspection Item

Discrepancy	Hours	Subtotal
361010/15- HIGH PRESSURE REGULATING VALVE (LEFT/RIGHT)- OPERATIONAL TEST;	Flat	825.00
361030- BLEED AIR MANIFOLD PRESSURE INDICATION- FUNCTIONAL TEST;		
362036/2536- PRECOOLER LOW PRESSURE INLINE FILTER (LEFT/RIGHT)- INSPECTION;		
363012- APU/EXTERNAL AIR CHECK VALVE- OPERATIONAL TEST;		

Corrective Action

361010/15- HIGH PRESSURE REGULATING VALVE (LEFT/RIGHT)- OPERATIONAL TEST;
 363012- APU/EXTERNAL AIR CHECK VALVE- OPERATIONAL TEST;
 361030- BLEED AIR MANIFOLD PRESSURE INDICATION- FUNCTIONAL TEST;
 362036/2536- PRECOOLER LOW PRESSURE INLINE FILTER LT/ RT- INSPECTION;

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
2		S8990-013	PACKING (P/O: start)		0.27	0.54

Labor: \$825.00	Parts: \$0.54	Shipping: \$0.00	Item Subtotal: \$825.54
------------------------	----------------------	-------------------------	--------------------------------

Item: 26 - Recommended Airframe

Discrepancy	Hours	Subtotal
380101- POTABLE WATER SYSTEM FILTER- REPLACE;	Flat	110.00

Corrective Action

NOT DUE AT THIS TIME.

Labor: \$110.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$110.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 27 - Inspection Item

Discrepancy	Hours	Subtotal
491510- APU OIL AND FILTER- CHANGE;	Flat	330.00
491535- APU EXTERNAL FUEL PRESSURE REGULATOR- OPERATIONAL TEST;		
Corrective Action		
491510 APU OIL CHANGE AND FILTER CHECK-SERVICE, SERVICED WITH 2380.		
491535- APU EXTERNAL FUEL PRESSURE REGULATOR- OPERATIONAL TEST;		

Labor: \$330.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$330.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 28 - Inspection Item

Discrepancy	Hours	Subtotal
515020- 24 MONTH HONEYCOMB- INSPECTION/BOND TEST;	Flat	880.00
Corrective Action		
515020- 24 MONTH HONEYCOMB- INSPECTION/BOND TEST		

Labor: \$880.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$880.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 29 - Inspection Item

Discrepancy	Hours	Subtotal
522515/16- MAIN ENTRANCE DOOR/BAGGAGE DOOR WARNING SYSTEM- OPERATIONAL TEST;	Flat	1,628.00
522520/30- MAIN/BAGGAGE DOOR INFLATABLE SEAL SYSTEM- OPERATIONAL TEST;		
522525- TAIL COMPARTMENT DOOR WARNING SYSTEM- OPERATIONAL TEST;		
522535- DOOR SEAL REGULATOR AND SYSTEM- INSPECTION;		
522545- MAIN ENTRANCE DOOR- INSPECTION;		
522555- MAIN ENTRANCE DOOR HINGE PINS- INSPECTION;		
523010/15- MAIN/BAGGAGE DOOR- LUBRICATION;		

Corrective Action
 522515/16- MAIN ENTRANCE DOOR/BAGGAGE DOOR WARNING SYSTEM- OPERATIONAL TEST;
 522520/30- MAIN/BAGGAGE DOOR INFLATABLE SEAL SYSTEM- OPERATIONAL TEST;
 522525- TAIL COMPARTMENT DOOR WARNING SYSTEM- OPERATIONAL TEST;
 522535- DOOR SEAL REGULATOR AND SYSTEM- INSPECTION;
 522545- MAIN ENTRANCE DOOR- INSPECTION;
 522555- MAIN ENTRANCE DOOR HINGE PINS- INSPECTION;
 523010/15- MAIN/BAGGAGE DOOR- LUBRICATION;

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
48		AN525-832R6	SCREW (P/O: STK-2637)		0.13	6.24
2		AN525-832R6	SCREW (P/O: STK-9304)		0.13	0.26

Labor: \$1,628.00	Parts: \$6.50	Shipping: \$0.00	Item Subtotal: \$1,634.50
--------------------------	----------------------	-------------------------	----------------------------------

Item: 30 - Inspection Item

Discrepancy	Hours	Subtotal
531010- NOSE COMPARTMENT/RADOME INTERIOR- INSPECTION;	Flat	275.00
531020- EXTERIOR FUSELAGE- INSPECTION;		
531510- TORSION BOX- INSPECTION;		
Corrective Action		
531010- NOSE COMPARTMENT/RADOME INTERIOR- INSPECTION;		
531020- EXTERIOR FUSELAGE- INSPECTION;		
531510- TORSION BOX- INSPECTION;		

Labor: \$275.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$275.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 31 - Inspection Item

Discrepancy	Hours	Subtotal
531520- MID FUSELAGE/WING FILLET INTERIOR- INSPECTION; 531530- AFT FUSELAGE INTERIOR- INSPECTION; 531540- TAIL CONE INTERIOR- INSPECTION;	Flat	1,100.00

Corrective Action

531520 MID FUSELAGE/WING FILLET INTERIOR-INSPECTION.
 537010 TAIL COMPARTMENT ABOVE FLOOR INSPECTION.
 531540 TAIL CONE INTERIOR-INSPECTION.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
74	EA	MS24694S51	SCREW		0.15	11.10
Labor:		Parts:		Shipping:		Item Subtotal:
\$1,100.00		\$11.10		\$0.00		\$1,111.10

Item: 32 - Inspection Item

Discrepancy	Hours	Subtotal
532010/2510- COCKPIT COMPARTMENT ABOVE/BELOW FLOOR- INSPECTION; 533010- COCKPIT COMPARTMENT BELOW PEDESTAL- INSPECTION; 533500- ENTRANCE COMPARTMENT BEHIND PANEL- INSPECTION; 533510- ENTRANCE COMPARTMENT ABOVE FLOOR- INSPECTION; 533520- ENTRANCE COMPARTMENT SHELF- INSPECTION; 534010- ENTRANCE COMPARTMENT BELOW FLOOR- INSPECTION;	Flat	3,740.00

Corrective Action

532010/2510- COCKPIT COMPARTMENT ABOVE/BELOW FLOOR- INSPECTION;
 533010- COCKPIT COMPARTMENT BELOW PEDESTAL- INSPECTION;
 533500- ENTRANCE COMPARTMENT BEHIND PANEL- INSPECTION;
 533510- ENTRANCE COMPARTMENT ABOVE FLOOR- INSPECTION;
 533520- ENTRANCE COMPARTMENT SHELF- INSPECTION;
 534010- ENTRANCE COMPARTMENT BELOW FLOOR- INSPECTION;

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
2		NAS517-3-10	SCREW		1.55	3.10
Labor:		Parts:		Shipping:		Item Subtotal:
\$3,740.00		\$3.10		\$0.00		\$3,743.10

Item: 33 - Inspection Item

Discrepancy	Hours	Subtotal
534510- CABIN COMPARTMENT ABOVE FLOOR- INSPECTION; 535510- AFT CABIN BELOW FLOOR- INSPECTION; 536010/6510- BAGGAGE COMPARTMENT ABOVE/BELOW FLOOR- INSPECTION; 536520- BAGGAGE COMPARTMENT BEHIND PANEL- INSPECTION; 537010/7510- TAIL COMPARTMENT ABOVE/BELOW FLOOR- INSPECTION;	Flat	3,905.00

Corrective Action

534510- CABIN COMPARTMENT ABOVE FLOOR- INSPECTION;
 535510- AFT CABIN BELOW FLOOR- INSPECTION;
 536010/536510- BAGGAGE COMPARTMENT ABOVE/BELOW FLOOR- INSPECTION;
 536520- BAGGAGE COMPARTMENT BEHIND PANEL- INSPECTION;
 537010/537510- TAIL COMPARTMENT ABOVE/BELOW FLOOR- INSPECTION;

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
4		MS21256-1	CLIP, TURNBUCKLE (P/O: STK-5059)		1.15	4.60
Labor:		Parts:		Shipping:		Item Subtotal:
\$3,905.00		\$4.60		\$0.00		\$3,909.60

Item: 34 - Inspection Item

Discrepancy	Hours	Subtotal
538010- NOSE WHEEL WELL AND GEAR- INSPECTION;	Flat	605.00
538510- MAIN LANDING GEAR WHEEL WELL- INSPECTION;		
538515- ENGINE FUEL FEED LINE (LEFT AND RIGHT)- INSPECTION;		
539010/20- MAIN LANDING GEAR INSTALLATION (LEFT/RIGHT)- INSPECTION;		

Corrective Action

538010- NOSE WHEEL WELL AND GEAR- INSPECTION
 539010/539020- MAIN LANDING GEAR INSTALLATION (LEFT/RIGHT)- INSPECTION;

Labor: \$605.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$605.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 35 - Inspection Item

Discrepancy	Hours	Subtotal
539425/26/27/28- BELOW EMERGENCY WINDOW CORROSION INSPECTION (LEFT 1/LEFT 2/RIGHT 1/RIGHT 2);	N/C	0.00

Corrective Action

539425/26/27/28- BELOW EMERGENCY WINDOW CORROSION INSPECTION (LEFT 1/LEFT 2/RIGHT 1/RIGHT 2);
 FOUND N/A AT THIS TIME, RECORDS SHOW 24 INITIAL C/W 11/2010, NEXT INSPECTION DUE AT 72 MONTHS (12/2016)

Notes:

100 MAN HOURS IS ESTIMATED- COULD BE ACCOMPLISHED AS TIME AND MATERIAL.
 NOTE, ONLY 3 WINDOWS SHOWED DUE IN CMP RUN.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 36 - Inspection Item

Discrepancy	Hours	Subtotal
541010/1510- PYLON EXTERIOR (LEFT/RIGHT)- INSPECTION;	Flat	3,190.00
541020/1520- PYLON INTERIOR (LEFT/RIGHT)- INSPECTION;		

Corrective Action

541010/1510 ACCOMPLISHED R/H AND L/H PYLON EXTERIOR INSPECTION PER GIIB AMM 05-01-00.
 541020/1520 ACCOMPLISHED L/H AND R/H PYLON INTERIOR INSPECTION PER GIIB AMM 05-01-00

Labor: \$3,190.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$3,190.00
--------------------------	----------------------	-------------------------	----------------------------------

Item: 37 - Inspection Item

Discrepancy	Hours	Subtotal
551025- RUDDER EXTERIOR- INSPECTION;	Flat	55.00

Corrective Action

551025- RUDDER EXTERIOR- INSPECTION;

Labor: \$55.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$55.00
-----------------------	----------------------	-------------------------	-------------------------------

Item: 38 - Inspection Item

Discrepancy	Hours	Subtotal
561010/15- EMERGENCY WINDOW RELEASE (INTERNAL/EXTERNAL)- OPERATIONAL TEST;	Flat	935.00
563513/14/15/16- CABIN EMERGENCY WINDOW DESICCANT FILTER (NO 1 LEFT/NO 2 LEFT/NO 1 RIGHT/NO 2 RIGHT)- INSPECTION;		
563517/18/19/20/21/22- CABIN FIXED WINDOW DESICCANT FILTER (1,2,3 LEFT/1,2,3 RIGHT)- INSPECTION;		

Corrective Action

561010/15- EMERGENCY WINDOW RELEASE (INTERNAL/EXTERNAL)- OPERATIONAL TEST;
 563513/14/15/16- CABIN EMERGENCY WINDOW DESICCANT FILTER (NO 1 LEFT/NO 2 LEFT/NO 1 RIGHT/NO 2 RIGHT)- INSPECTION;
 563517/18/19/20/21/22- CABIN FIXED WINDOW DESICCANT FILTER (1,2,3 LEFT/1,2,3 RIGHT)- INSPECTION;

Labor: \$935.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$935.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 39 - Inspection Item

Discrepancy	Hours	Subtotal
575045/50- WING TANK INTERIOR (LEFT/RIGHT)- INSPECTION;	Flat	6,600.00

Corrective Action
 575045/50- WING TANK INTERIOR (LEFT/RIGHT)- INSPECTION;

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
32	EA	NAS517-3-2	SCREW (PKG 100) (P/O: STK-8931)		0.15	4.80

Labor: \$6,600.00	Parts: \$4.80	Shipping: \$0.00	Item Subtotal: \$6,604.80
--------------------------	----------------------	-------------------------	----------------------------------

Item: 40 - Inspection Item

Discrepancy	Hours	Subtotal
575047/52- WING SPLICE FAIL-SAFE CHANNELS BL 135-156 (LEFT/RIGHT)- NDT INSPECTION; 575156/57- WING TO FUSELAGE ATTACHMENTS FS 452 BL 33 (LEFT/RIGHT)- ULTRASONIC AND VISUAL CORROSION INSPECTION;	Flat	2,640.00

Corrective Action
 575047/52- WING SPLICE FAIL-SAFE CHANNELS BL 135-156 (LEFT/RIGHT)- NDT INSPECTION;
 575156/57- WING TO FUSELAGE ATTACHMENTS FS 452 BL 33 (LEFT/RIGHT)- ULTRASONIC AND VISUAL CORROSION INSPECTION; NDT ACCOMPLISHED BY STS, CRS ES1R124K UNDER WO 11170
 Outside Repair:
 Structural Testing Systems I - Invoice #11170, Labor: 3,215.50, Parts: 0.00
 (NDT WING SPLICE CHANNELS.)

Labor: \$5,855.50	Parts: \$0.00	Shipping: \$2,160.00	Item Subtotal: \$8,015.50
--------------------------	----------------------	-----------------------------	----------------------------------

Item: 41 - Inspection Item

Discrepancy	Hours	Subtotal
575055/60- WING LEADING EDGE GAP BAND INTERIOR (LEFT/RIGHT)- INSPECTION;	Flat	1,320.00

Corrective Action
 575055/60- WING LEADING EDGE GAP BAND INTERIOR (LEFT/RIGHT)- INSPECTION;

Labor: \$1,320.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$1,320.00
--------------------------	----------------------	-------------------------	----------------------------------

Item: 42 - Inspection Item

Discrepancy	Hours	Subtotal
711020/711020- POWERPLANT (INTERNAL) LEFT/RIGHT- INSPECTION; 761010/761010- ENGINE CONTROLS (LEFT/RIGHT) SERVICE/ LUBRICATION; 771010/771010- TURBINE GAS TEMPERATURE (LEFT/RIGHT)- VALIDATION; 801515/30- ENGINE STARTER (LEFT/RIGHT)- OIL LEVEL CHECK;	Flat	2,200.00

Corrective Action
 711020/711020- POWERPLANT (INTERNAL) LEFT/RIGHT- INSPECTION;
 761010/761010- ENGINE CONTROLS (LEFT/RIGHT) SERVICE/ LUBRICATION;
 771010/771010- TURBINE GAS TEMPERATURE (LEFT/RIGHT)- VALIDATION;
 801515/30- ENGINE STARTER (LEFT/RIGHT)- OIL LEVEL CHECK;

Labor: \$2,200.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$2,200.00
--------------------------	----------------------	-------------------------	----------------------------------

Item: 43 - Inspection Item

Discrepancy	Hours	Subtotal
751510/1510- ENGINE ANTI-ICE SYSTEM (LEFT/RIGHT)- OPERATIONAL TEST;	Flat	440.00

Corrective Action
 751510/1510- ENGINE ANTI-ICE SYSTEM (LEFT/RIGHT)- OPERATIONAL TEST;

Labor: \$440.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$440.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 44 - Inspection Item

Discrepancy	Hours	Subtotal
781010/15- ENGINE THRUST REVERSER SYSTEM (LEFT/RIGHT)- OPERATIONAL TEST;	Flat	1,925.00
781030/35- THRUST REVERSER (HUSH KIT) (LEFT/RIGHT)- INSPECTION;		
782530/35- THRUST REVERSER INTERLOCK FEEDBACK SYSTEM- OPERATIONAL TEST;		

Corrective Action

781010/15- ENGINE THRUST REVERSER SYSTEM -LEFT/RIGHT- OPERATIONAL TEST;
781030/35- THRUST REVERSER (HUSH KIT) -LEFT/RIGHT- INSPECTION;
LEFT THRUST REVERSER REMOVED AND REPAIRED BY QTA, CRS Q9TR440N UNDER WO
12-10-149, AND REINSTALLED (LOG ENTRY SUPPLIED).

Labor: \$1,925.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$1,925.00
--------------------------	----------------------	-------------------------	----------------------------------

Item: 45 - Inspection Item

Discrepancy	Hours	Subtotal
221026/28- ADC #1/#2- CALIBRATION CHECK;	Flat	1,800.00
341050/51- PILOT/COPILOT- PITOT STATIC SYSTEM -RECERTIFICATION;		
341110/15/16- PILOT/COPILOT/STANDBY ALTIMETER- CALIBRATION;		
343531/32- ATC #1/#2- TEST/INSP (FAR91.413)		

Corrective Action

FAR 91.411/413 REQUIREMENTS
CMP CODE 221026/28 ADC #1/#2-CALIBRATION CHECK;
CMP CODE 341050/51 PILOT/COPILOT-PITOT STATIC SYSTEM RECERTIFICATION;
CMP CODE 341110/15/16 PILOT/CO-PILOT/STAND-BY ALTIMETER CALIBRATION;
CMP CODE 343531/32 ATC #1/#2 TEST/INSPECTION;

THE ALTIMETER SYSTEM, ALTITUDE REPORTING EQUIPMENT AND ATC TRANSPONDER TESTS
REQUIRED BY FAR 91.411(a)(3) AND 91.413(b) HAVE BEEN PERFORMED AND DETERMINED TO BE
IN COMPLIANCE WITH PARAGRAPH (c) FAR 43 APPENDIX E AND F.

Labor: \$1,800.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$1,800.00
--------------------------	----------------------	-------------------------	----------------------------------

Item: 46 - Inspection Item

Discrepancy	Hours	Subtotal
C/W CUSTOMER APPROVED RVSM INSPECTION	3.00	330.00

Corrective Action

PERFORMED SATISFACTORY RVSM CONFORMITY INSPECTION IN ACCORDANCE WITH
GULFSTREAM DOC. CE21 134A001. THE AIRCRAFT IS RVSM COMPLIANT AT THIS TIME.

Labor: \$330.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$330.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 47 - Discrepancy

Discrepancy	Hours	Subtotal
PLASTIC TRIM INSIDE LEFT AFT EMERGENCY WINDOW IS MELTED	2.50	275.00

Corrective Action

REMOVED LEFT AFT EMER WINDOW, DISASSEMBLED DECORATIVE INNER PANEL. PANEL
REPAIRED BY CUSTOM AIRCRAFT, REASSEMBLED AND REINSTALLED WINDOW.RE-INSTALLED
WINDOW.

Labor: \$275.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$275.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 48 - Discrepancy

Discrepancy	Hours	Subtotal
LIGHT (UPWASH) AT VIP SEAT FLICKERS, CHECK LAV VALANCE AND DOME LIGHTS FOR OPERATION	6.59	724.90

Corrective Action

TROUBLESHOT INTERMITTENT VIP UPWASH LIGHT ,INCORRECT WIRING CONNECTION AT FAULT.
RE-CONNECT WIRING IN ACCORDANCE WITH B/E AEROSPACE CABIN LED LIGHTING SYSTEM
INSTALLATION DWG NO. JRW0706-WD .PERFORMED SATISFACTORY FUNCTIONAL CHECK OF VIP
SEAT UPWASH AND LAVATORY VALANCE AND DOME LIGHT CHECK ,NO DEFECTS NOTED.

Labor: \$724.90	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$724.90
------------------------	----------------------	-------------------------	--------------------------------

Item: 49 - Discrepancy

Discrepancy	Hours	Subtotal
WHILE INSTALLING L/H ENGINE FIRE BOTTLE AFTER PERFORMING FIRE EXTINGUISHER SYSTEM FUNCTIONAL CHECK, AFT SQUIBB NEGATIVE WIRE TERMINAL END BROKE.	0.50	55.00

Corrective Action

REPLACED BROKEN NEGATIVE WIRE TERMINAL ON L/H ENGINE FIRE BOTTLE AFT SQUIBB PER STANDARD PRACTICES.

Labor: \$55.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$55.00
-----------------------	----------------------	-------------------------	-------------------------------

Item: 50 - Discrepancy

Discrepancy	Hours	Subtotal
VARIOUS SCREWS IN UPPER AND LOWER FUEL TANK INSPECTION PANELS REQUIRE EXTRACTION. TORQUE BOX SCREW EXTRACTION.	9.00	990.00

STRIPPED AND CORRODED HARDWARE IN VARIOUS PANEL AND ACCESS COVERS: MLG AREA.

Corrective Action

VARIOUS SCREWS IN UPPER AND LOWER FUEL TANK INSPECTION PANELS REQUIRE EXTRACTION. TORQUE BOX SCREW EXTRACTION. STRIPPED AND CORRODED HARDWARE IN VARIOUS PANEL AND ACCESS COVERS: MLG AREA. REMOVED DEFECTIVE HARDWARE AS REQUIRED.

Labor: \$990.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$990.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 51 - Discrepancy

Discrepancy	Hours	Subtotal
LEFT WING UPPER FUEL PANEL (-23) SEAL MISS-SHAPEN(P/N 1159WM20049-11), LOWER AFT PANEL (-4) HAS CORROSION ON DOME NUTS.	2.25	247.50

Corrective Action

REMOVED LEFT WING UPPER FUEL CELL PANEL (-23) FOR INSPECTION. CLEANED, INSPECTED, AND INSTALLED NEW PANEL SEAL USING P/N S38113-3009. REINSTALLED PANEL, AND TORQUED PER M/M SECTION 57-00-00.

REMOVED LOWER LEFT FUEL CELL PANEL (-4) FOR INSPECTION. REMOVED SEALANT FROM CORRODED DOME NUTPLATES. INSPECTED AND RESEALED DOME NUTPLATES USING PRC-1422/A-2.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1		1159SB20507-1	PANEL (P/O: TRN-10419)		600.00	600.00
1		S38113-3009	SEAL (P/O: TRN-10419)		93.60	93.60

Labor: \$247.50	Parts: \$693.60	Shipping: \$0.00	Item Subtotal: \$941.10
------------------------	------------------------	-------------------------	--------------------------------

Item: 52 - Discrepancy

Discrepancy	Hours	Subtotal
LEFT AND RIGHT HORIZONTAL TIP CAP STATIC WICKS FAILED INSPECTION	5.50	605.00

P/N NFD-811 OR 71-427

Corrective Action

REMOVED AND REPLACED RIGHT AND LEFT HORIZONTAL TIP CAP STATIC DISCHARGERS WITH NEW DISCHARGERS P/N 71-427.

Notes:

EXTRA TIME REQUIRED DUE TO SET SCREWS STRIPPED OUT - WC

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
2	EA	71-427	STATIC WICK (P/O: TRN-10348)		100.00	200.00

Labor: \$605.00	Parts: \$200.00	Shipping: \$0.00	Item Subtotal: \$805.00
------------------------	------------------------	-------------------------	--------------------------------

Item: 53 - Discrepancy

Discrepancy	Hours	Subtotal
TAIL CONE STATIC WICK FAILED INSPECTION	0.50	55.00

Corrective Action
 REPLACED TAIL CONE STATIC WICK P/N 71-425 IAW GIIB 23-00-00.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1		71-425	STATIC WICK (P/O: start)		118.75	118.75
Labor: \$55.00		Parts: \$118.75		Shipping: \$0.00		Item Subtotal: \$173.75

Item: 54 - Discrepancy

Discrepancy	Hours	Subtotal
RIGHT WING OUTBOARD MIDDLE STATIC WICK FAILED INSPECTION	1.00	110.00

Corrective Action
 REPLACED RIGHT WING OUTBOARD MIDDLE STATIC WICK P/N 71-425 IAW GIIB 23-00-00.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1		71-425	STATIC WICK (P/O: start)		118.75	118.75
Labor: \$110.00		Parts: \$118.75		Shipping: \$0.00		Item Subtotal: \$228.75

Item: 55 - Discrepancy

Discrepancy	Hours	Subtotal
WHILE COMPLYING WITH BLEED AIR MANIFOLD PRESSURE INDICATION - FUNCTIONAL TEST FOUND THAT THE OVERPRESSURE PORTION OF THE CHECK FAILED. "BLEED PRESS" LIGHT DID NOT COME ON AT 90 PSI.	3.50	385.00

Corrective Action
 REMOVED BLEED OVERPRESSURE SWITCH P/N 8159, S/N OFF 1005, INSTALLED NEW PART P/N 8159, S/N 1215 (FROM GULFSTREAM AEROSPACE CORP, W.O. # SAP010-45608) IAW GIIB M/M 36-00-00. OPS CHECK GOOD.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1		8159	SWITCH (P/O: TRN-10389) (Ship: 49.00)		1,378.14	1,378.14
1		AN784-4	FITTING (P/O: TRN-10389) (Ship: 22.00)		46.00	46.00
1	EA	MS28778-4	PACKING (P/O: STK-9240)		0.57	0.57
Labor: \$385.00		Parts: \$1,424.71		Shipping: \$71.00		Item Subtotal: \$1,880.71

Item: 56 - Discrepancy

Discrepancy	Hours	Subtotal
254010 - FIRST AID KITS INSPECTION DUE FOR CONVENIENCE.	0.50	55.00

Corrective Action
 REMOVED 2 EACH FIRST AID KITS FOR RECERTIFICATION BY MEDAIRE. HARD TIME DUE 12/29/12. INSTALLED SAME KITS, NO INSPECTION AT THIS TIME.

Labor: \$55.00		Parts: \$0.00		Shipping: \$0.00		Item Subtotal: \$55.00
-----------------------	--	----------------------	--	-------------------------	--	-------------------------------

Item: 57 - Discrepancy

Discrepancy	Hours	Subtotal
STRIPPED AND BROKEN NUTPLATES IN MLG AREA ON DG COVER.	3.00	330.00

Corrective Action

REMOVED STRIPPED SCREWS IN DG COVER IN MLG WHEEL WELL CENTER SECTION AND REPLACED 3 EACH BROKEN AND RUSTED NUTPLATES. INSTALLED DG COVER USING 6 NEW SCREWS SCREWS. ALL WORK COMPLETED IAW SECTION 20-00-00 OF M/M

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
6	EA	AN525-10R7	SCREW (P/O: STK-5047)		0.14	0.84
3	EA	MS21075L3N	NUTPLATES (P/O: 882)		0.67	2.01

Labor: \$330.00	Parts: \$2.85	Shipping: \$0.00	Item Subtotal: \$332.85
------------------------	----------------------	-------------------------	--------------------------------

Item: 58 - Discrepancy

Discrepancy	Hours	Subtotal
RIGHT AND LEFT WINDSCREEN SCREWS HAS CORROSION.	0.00	0.00

Corrective Action

CUSTOMER NOTIFIED

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 59 - Discrepancy

Discrepancy	Hours	Subtotal
NOSE CONE-TOP- COMPOSITE SHOWING.	0.00	0.00

Corrective Action

CUSTOMER NOTIFIED

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 60 - Discrepancy

Discrepancy	Hours	Subtotal
RIGHT WING INSPECTION LIGHT HAS CORROSION.	0.00	0.00

Corrective Action

CUSTOMER NOTIFIED

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 61 - Discrepancy

Discrepancy	Hours	Subtotal
O2 DOOR AND LATCHES HAS BROKEN SPRINGS.	0.00	0.00

Corrective Action

CUSTOMER NOTIFIED

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 62 - Discrepancy

Discrepancy	Hours	Subtotal
TAIL CONE INTERIOR -2ND RIB AFT- HAS PRIMER BUBBLING UP.	1.00	110.00

Corrective Action

CLEANED AND TREATED BARE METAL AS REQUIRED IN TAIL CONE INTERIOR -2ND RIB AFT WERE PRIMER WAS BUBBLING UP.

Labor: \$110.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$110.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 63 - Discrepancy

Discrepancy	Hours	Subtotal
DURING L/H PYLON EXT INSP. FOUND PANEL 29 LWR 3A MISSING PAINT AND PRIMER.	0.00	0.00
Corrective Action		
CUSTOMER NOTIFIED		

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 64 - Discrepancy

Discrepancy	Hours	Subtotal
DURING L/H PYLON EXTERIOR INSP. FOUND SEVERAL PANEL SCREWS WITH CORROSION.	0.50	55.00
Corrective Action		
REPLACED SCREWS AS REQUIRED ON LEFT PYLON UPPER		

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
52	EA	NAS517-4-13	BOLT		0.88	45.76
25		NAS517-4-9	BOLT		0.55	13.75

Labor: \$55.00	Parts: \$59.51	Shipping: \$0.00	Item Subtotal: \$114.51
-----------------------	-----------------------	-------------------------	--------------------------------

Item: 65 - Discrepancy

Discrepancy	Hours	Subtotal
DURING R/H PYLON EXT. INSP. FOUND SEVERAL PANEL SCREWS WITH CORROSION.	0.50	55.00
Corrective Action		
REPLACED SCREWS AS REQUIRED ON RIGHT PYLON UPPER		

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
52	EA	NAS517-4-13	BOLT		0.88	45.76
25		NAS517-4-9	BOLT		0.55	13.75

Labor: \$55.00	Parts: \$59.51	Shipping: \$0.00	Item Subtotal: \$114.51
-----------------------	-----------------------	-------------------------	--------------------------------

Item: 66 - Discrepancy

Discrepancy	Hours	Subtotal
#2 ENGINE THRUST REVERSER CONTROL VALVE CONTROL ROD END HAS SURFACE CORROSION.	1.00	110.00
Corrective Action		
#2 ENGINE THRUST REVERSER CONTROL VALVE CONTROL ROD END HAS SURFACE CORROSION. CLEANED SURFACE CORROSION AND TREATED I.A.W. STANDARD PRACTICES. NO FURTHER ACTION REQUIRED.		

Labor: \$110.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$110.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 67 - Discrepancy

Discrepancy	Hours	Subtotal
DURING TAIL COMPARTMENT ABOVE FLOOR INSP. FOUND SKYDROL CAUSING PRIMER TO BUBBLE AND EXPOSING BARE METAL UNDER HYDRAULIC RESERVOIR AND AFT OF RESERVOIR ALONG STRINGER. ALSO ON L/H SIDE AS YOU WALK UP THE STAIRS BENEATH SEVERAL HYDRAULIC CONNECTIONS PRIMER IS ALSO PEELING OFF EXPOSING BARE METAL.	0.00	0.00
Corrective Action		
CUSTOMER NOTIFIED		

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 68 - Discrepancy

Discrepancy	Hours	Subtotal
ENGINE FORWARD THRUST REVERSER CONTROL CABLE IN MLG WHEEL WELL TENSION BELOW TOLERANCE.	2.00	220.00
ENGINE HIGH PRESSURE FUEL SHUTOFF CABLE TENSION BELOW TOLERANCE.		

Corrective Action

ADJUSTED LEFT AND RIGHT THRUST REVERSER CONTROL CABLES AT MLG WHEEL WELL TO OPERATIONAL LIMITS AND RESAFETIED.

ADJUSTED LEFT AND RIGHT ENGINE HIGH PRESSURE FUEL SHUTOFF CONTROL CABLES AT MLG WHEEL WELL TO OPERATIONAL LIMITS AND RESAFETIED.

Labor: \$220.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$220.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 69 - Discrepancy

Discrepancy	Hours	Subtotal
NOSE GEAR DOOR ACTUATOR 45 DEG FITTING CORRODED.	0.50	55.00

Corrective Action

REMOVED LIGHT SURFACE CORROSION AND TREATED WITH AV-30 CORROSION INHIBITOR.

Labor: \$55.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$55.00
-----------------------	----------------------	-------------------------	-------------------------------

Item: 70 - Discrepancy

Discrepancy	Hours	Subtotal
DURING INSPECTION OF MLG CENTER SECTION, NOTED DESICCANT FOR VG'S TO BE PINK REQUIRING REPLACEMENT.	0.75	82.50

Corrective Action

INSTALLED NEW DESICCANT CONTAINERS, P/N 23311 IN BOTH VG'S PER ORIGINAL INSTALLATION.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
2	EA	23311	DESICCANT HOLDER (P/O: TRN-10375) (Ship: 9.00)		102.00	204.00

Labor: \$82.50	Parts: \$204.00	Shipping: \$9.00	Item Subtotal: \$295.50
-----------------------	------------------------	-------------------------	--------------------------------

Item: 71 - Discrepancy

Discrepancy	Hours	Subtotal
TOUCH UP PAINT IS NEEDED ON RIGHT SIDE OF RUDDER, BARE METAL SHOWING	1.00	110.00

Corrective Action

TOUCHED UP PAINT AS NEEDED ON RIGHT SIDE OF RUDDER.

Labor: \$110.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$110.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 72 - Discrepancy

Discrepancy	Hours	Subtotal
RIGHT T/R DOES NOT ARM, WILL NOT DEPLOY SUSPECT FIRE TEE HANDLE SWITCH- SEVERAL BULBS INOP ON BOTH T/R INDICATIONS.	6.00	660.00

Corrective Action

RIGHT T/R DOES NOT ARM, WILL NOT DEPLOY. SUSPECT FIRE TEE HANDLE SWITCH- SEVERAL BULBS INOP ON BOTH T/R INDICATIONS. REMOVED AND REPLACE 327 FOR ARM LIGHT. ARM LIGHT STILL INOP. GAINED ACCESS TO T HANDLE #1 SWITCH. CHECKED INPUT AND OUTPUT POWER AT SWITCH WHILE ACTUATING SWITCH. SWITCH SEEMS TO BE WORKING. GAINED ACCESS TO T/R CONTROL VALVE. FROM CONNECTOR DIRTY AT VALVE CLEANED CONNECTOR. CHECKED POWER ON PIN A. 28VDC POWER ON PIN A. CHECKED GOOD GROUND ALSO. RECHECKED ARM LIGHT AGAIN AND NOW ARM LIGHT WORKS. DEPLOYED RIGHT T/R AS REQUIRED. CLOSED UP AREAS OPENED FOR TROUBLESHOOTING. WORK IAW GIIIB M/M 78-00-00.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1	EA	327	BULB (P/O: STK-9415)		1.25	1.25
2	EA	327	BULB (P/O: STK-9415)		1.25	2.50

Labor: \$660.00	Parts: \$3.75	Shipping: \$0.00	Item Subtotal: \$663.75
------------------------	----------------------	-------------------------	--------------------------------

Item: 73 - Discrepancy

Discrepancy	Hours	Subtotal
LEFT AND RIGHT HYDRAULIC SYSTEM TRANSMITTERS NEED SAFETY	0.25	27.50

Corrective Action

SAFETY WIRED LEFT AND RIGHT HYDRAULIC SYSTEM TRANSMITTERS AS REQUIRED.

Labor: \$27.50	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$27.50
-----------------------	----------------------	-------------------------	-------------------------------

Item: 74 - Discrepancy

Discrepancy	Hours	Subtotal
CORRODED RIVET HEAD FORWARD FROM PANEL 107-LH-4	1.50	165.00

Corrective Action

CORRODED RIVET HEAD FORWARD FROM PANEL 107-LH-4. REMOVED RIVET, CLEANED AREA AND REPLACED RIVET IAW GIIIB SRM 51-00-00.

Labor: \$165.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$165.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 75 - Discrepancy

Discrepancy	Hours	Subtotal
WHILE COMPLYING WITH CMP 534010 ENTRANCE COMPARTMENT BELOW FLOOR - INSPECTION FOUND FLR-15 WITH CORROSION ON PANEL.	2.00	220.00

Corrective Action

WHILE COMPLYING WITH CMP 534010 ENTRANCE COMPARTMENT BELOW FLOOR - INSPECTION FOUND FLR-15 WITH CORROSION ON PANEL. REMOVED LIGHT SURFACE CORROSION AND TREATED / PAINTED BOARD AS REQUIRED IAW GIIIB SRM 51-00-00.

Labor: \$220.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$220.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 76 - Discrepancy

Discrepancy	Hours	Subtotal
MED FORWARD HINGE PIN FROZEN.	1.00	110.00

PIN P/N 159BM10108-1

Corrective Action

MED FORWARD HINGE PIN FROZEN. REMOVED AND REPLACED BOTH MED HINGE PINS P/N 159BM10108-1 IAW GIIIB M/MJ 52-01-00.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
2		159BM10108-1	PIN (P/O: TRN-10385)		89.00	178.00

Labor: \$110.00	Parts: \$178.00	Shipping: \$0.00	Item Subtotal: \$288.00
------------------------	------------------------	-------------------------	--------------------------------

Item: 77 - Discrepancy

Discrepancy	Hours	Subtotal
CO-PILOTS ADDU STAND BY FUNCTION ERRATIC	4.00	440.00

Corrective Action

REMOVED PILOTS ADDU P/N 9D-80110-6 S/N 13475 AND INSTALLED IN CO-PILOTS POSITION.
 REMOVED CO-PILOTS ADDU P/N 9D-80110-6 S/N 13473 AND INSTALLED IN PILOTS POSITION FOR
 TROUBLE SHOOTING PURPOSE.PERFORMED SATISFACTORY FUNCTIONAL CHECK.NO DEFECTS
 NOTED. RE-INSTALLED ADDU'S TO ORIGINAL CONFIGURATION. PERFORMED RECONNECT
 CHECK.

Labor: \$440.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$440.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 78 - Discrepancy

Discrepancy	Hours	Subtotal
AD2010-07-02 HONEYWELL PRIMUS II RNZ-850/-851	0.50	55.00

Corrective Action

AD2010-07-02 (CMP 993004) HONEYWELL PRIMUS II RNZ-850/-851, IS N/A BY AFFECTED
 EQUIPMENT NOT INSTALLED.

Labor: \$55.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$55.00
-----------------------	----------------------	-------------------------	-------------------------------

Item: 79 - Discrepancy

Discrepancy	Hours	Subtotal
CRACK FOUND ON LEFT T/R INBOARD BEAM ASSEMBLY.	4.00	440.00

Corrective Action

ITEM HAS BEEN DYE PENNED AND CONFIRMED CRACKED. CRACK HAS BEEN FLAGGED. TOOK
 PHOTO OF CRACK AND EMAILED TO CUSTOMER. QTA TO COME ON-SITE TO COMPLY WITH
 REPAIR.

Outside Repair:
 Quiet Technologies - Invoice #MJC102312, Labor: 14,000.00, Parts: 0.00
 (REMOVE LEFT T/R, ACCOMPLISH REQUIRED REPAIRS. REINSTALL AND RIG)

Labor: \$14,440.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$14,440.00
---------------------------	----------------------	-------------------------	-----------------------------------

Item: 80 - Discrepancy

Discrepancy	Hours	Subtotal
COCKPIT FLOOR PANEL STRIPPED SCREW EXTRACTION	2.25	247.50

Corrective Action

EXTRACTED MULTIPLE SCREWS FROM AFT FLOORBOARD.

Labor: \$247.50	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$247.50
------------------------	----------------------	-------------------------	--------------------------------

Item: 81 - Discrepancy

Discrepancy	Hours	Subtotal
LEFT ENGINE:	0.00	0.00

BOTTOM COWL PAINT PEEING, BLEED AIR EXHAUST SIGNS OF BLEED AIR LEAK.
 TOP COWL; SIGNS OF BLEED AIR LEAKS, EPR CANISTER LINE SIGNS OF CORROSION.
 THRUST REV. SIGNS OF OIL LEAK.

Corrective Action

CUSTOMER ADVISED

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 82 - Discrepancy

Discrepancy	Hours	Subtotal
RIGHT ENGINE: TOP COWL, HARDWARE SIGNS OF CORROSION, SIGNS OF BLEED AIR LEAKS, PAINT PEELING, T1 LINE SIGNS OF CORROSION LATCHES SIGNS OF CORROSION. THRUST REV. SIGNS OF OIL LEAKS.	0.00	0.00

Corrective Action
CUSTOMER ADVISED

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
----------------------	----------------------	-------------------------	------------------------------

Item: 83 - Discrepancy

Discrepancy	Hours	Subtotal
MED FORWARD UPPER CABLE TENSION LOW	1.00	110.00

Corrective Action
MED FORWARD UPPER CABLE TENSION LOW. TENSIONED CABLE AS REQUIRED IAW GIIB M/M
52-10-00.

Labor: \$110.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$110.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 84 - Discrepancy

Discrepancy	Hours	Subtotal
REMOVE BOTH THRUST REVERSERS FOR STAGE 3 MODIFICATION- TRACKING ITEM FOR ASSIST, STC PURCHASED DIRECTLY BY CUSTOMER.	8.00	880.00

Corrective Action
CANX BY CUSTOMER, HAD ATTEMPTED PYLON PANEL REMOVAL FOR ACCESS PRIOR TO CALL.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1		AW-1-7/8-27-E5	GAUGE (P/O: TRN-10419)		2,820.00	2,820.00

Labor: \$880.00	Parts: \$2,820.00	Shipping: \$0.00	Item Subtotal: \$3,700.00
------------------------	--------------------------	-------------------------	----------------------------------

Item: 85 - Discrepancy

Discrepancy	Hours	Subtotal
ELT SETS OFF UNCOMMANDED	3.50	385.00

Corrective Action
TROUBLE-SHOT ELT DUE TO UNCOMMANDED ACTIVATION. REMOVED DEFECTIVE ELT REMOTE
SWITCH P/N345-6196-04 REV D S/N356230-018 AND INSTALLED NEW SWITCH 345-6196-04 REV D
S/N 3566196-023 TASK ACCOMPLISHED IN ACCORDANCE WITH DOCUMENT NO. G2B-20895-050
REV:IR
SEALED ELT HARNESS CONNECTOR IN ACCORDANCE WITH COBHAM AVIONICS CMM 25-62-11.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1		345-6196-04	ELT SWITCH (P/O: TRN-10415) (Ship: 7.05)		72.00	72.00

Labor: \$385.00	Parts: \$72.00	Shipping: \$7.05	Item Subtotal: \$464.05
------------------------	-----------------------	-------------------------	--------------------------------

Item: 86 - Discrepancy

Discrepancy	Hours	Subtotal
BOTH NOSE GEAR FLYING DOOR PUSH ROD ENDS ARE WORN OR BROKEN	2.50	275.00

Corrective Action
REPLACED BOTH NOSE GEAR AFT FAIRING DOOR PUSHROD ENDS WITH NEW P/N MS21151-8
AND ADJUSTED PER MM 32. DOOR NOW FAIRS PROPERLY WITH GEAR UP. COMPLIED WITH
GEAR SWINGS. OPS CHECK GOOD.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
2		MS21151-8	ROD-END (P/O: TRN-10416)		121.80	243.60

Labor: \$275.00	Parts: \$243.60	Shipping: \$0.00	Item Subtotal: \$518.60
------------------------	------------------------	-------------------------	--------------------------------

Item: 87 - Discrepancy

Discrepancy	Hours	Subtotal
CREW OXYGEN SYSTEM (EXTERNAL LOWER GAUGE) LEAKS DOWN	4.50	495.00

Corrective Action

REMOVED CREW OXYGEN SYSTEM GAUGE P/N AW-1-7/8-27-E5, S/N 10475. INSTALLED TEST CALIBRATED & RECERTIFIED GAUGE P/N ON AW-1-7/8-27-E5, S/N 14606. WORK IAW GIIB M/M 35-00-00.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
14		AN525-832R6	SCREW (P/O: STK-9304)		0.13	1.82
2		AN525-832R6	SCREW (P/O: STK-9304)		0.15	0.30
1	EA	M83248/1-008	PACKING (P/O: STK-6866)		0.25	0.25
1	EA	OXYGEN	OXYGEN SERVICE CHARGE		40.00	40.00
1	EA	OXYGEN	OXYGEN SERVICE CHARGE		40.00	40.00

Labor: \$495.00	Parts: \$82.37	Shipping: \$0.00	Item Subtotal: \$577.37
------------------------	-----------------------	-------------------------	--------------------------------

Item: 88 - Discrepancy

Discrepancy	Hours	Subtotal
ADDITIONAL CORE CHARGE FOR CUSTOMERS CORE UNIT	0.00	0.00

Corrective Action

ADDITIONAL CORE CHARGE FOR CUSTOMERS CORE UNIT

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1		FR141-A2 (CORE)	UNIT INSTALLED IN JULY AND REMOVED IN AUGUST. REQUIRED REPAIR & RECERT. (WARRANTY DENIED) REF: WO 12-09025		1,820.00	1,820.00

Labor: \$0.00	Parts: \$1,820.00	Shipping: \$0.00	Item Subtotal: \$1,820.00
----------------------	--------------------------	-------------------------	----------------------------------

Item: 89 - Discrepancy

Discrepancy	Hours	Subtotal
RAT TEMPERATURE INDICATION ERRATIC ON CO-PILOTS PFD.	3.25	357.50

Corrective Action

PERFORMED SATISFACTORY OPERATIONAL ,NO DEFECTS NOTED AT THIS TIME.

Labor: \$357.50	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$357.50
------------------------	----------------------	-------------------------	--------------------------------

Item: 90 - Discrepancy

Discrepancy	Hours	Subtotal
SEVERAL LEFT PYLON PANELS HAVE STRIPPED SCREWS, AND BROKEN NUTPLATES	4.00	440.00

Corrective Action

REPLACED SEVERAL LEFT PYLON PANELS HAVE STRIPPED SCREWS, AND BROKEN NUTPLATES AS REQUIRED.

Labor: \$440.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$440.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 91 - Discrepancy

Discrepancy	Hours	Subtotal
BAGGAGE COMP LOWER PANEL CARPET NOT HOLDING- REPLACE/RESECURE VELCRO	1.30	143.00

Corrective Action

BAGGAGE COMP LOWER PANEL CARPET NOT HOLDING- REPLACED/RESECURED VELCRO

Labor: \$143.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$143.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 92 - Customer Requested

Discrepancy	Hours	Subtotal
REQUESTING CARPET EXTRACTION	Flat	375.00
Corrective Action		
PERFORMED CARPET EXTRACTION		

Labor: \$375.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$375.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 93 - Discrepancy

Discrepancy	Hours	Subtotal
RH LOWER #2 PYLON BOARD HAS NUTPLATE THAT IS BENT UP AND THE SCREW WILL NOT START	1.00	110.00
Corrective Action		
RH LOWER #2 PYLON BOARD HAS NUTPLATE THAT IS BENT UP AND THE SCREW WILL NOT START. REMOVED BENT NUTPLATE, STRAIGHTEN AND REINSTALLED. OPS CHECKED NORMAL.		

Labor: \$110.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$110.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 94 - Customer Requested

Discrepancy	Hours	Subtotal
INTERIOR/ EXTERIOR DETAILING POST INSPECTION	N/C	0.00
Corrective Action		
PERFORMED INTERIOR/ EXTERIOR WIPE DOWN TOUCH UPS POST INSPECTION		

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
2	EA	03520	ZEROTRI DEGREASER - LPS (P/O: STK-10047)		24.00	48.00

Labor: \$0.00	Parts: \$48.00	Shipping: \$0.00	Item Subtotal: \$48.00
----------------------	-----------------------	-------------------------	-------------------------------

Item: 95 - Customer Requested

Discrepancy	Hours	Subtotal
EXTERIOR WASH	Flat	925.00
Corrective Action		
COMPLY WITH EXTERIOR WASH		

Labor: \$925.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$925.00
------------------------	----------------------	-------------------------	--------------------------------

Item: 96 - Discrepancy

Discrepancy	Hours	Subtotal
C/W POSTFLIGHT INSPECTION.	3.25	357.50
Corrective Action		
C/W POSTFLIGHT INSPECTION.		

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
4	EA	2380QT	OIL (P/O: STK-10333)		18.90	75.60
1	EA	NITROGEN, LOW	NITROGEN LOW PRESSURE CHARGE		20.00	20.00

Labor: \$357.50	Parts: \$95.60	Shipping: \$0.00	Item Subtotal: \$453.10
------------------------	-----------------------	-------------------------	--------------------------------

Item: 97 - Discrepancy

Discrepancy	Hours	Subtotal
MULTIPLE AIRSTAIR LIGHTS INOP.	2.50	275.00

Corrective Action

MULTIPLE AIRSTAIR POST LIGHTS INOPERATIVE DUE TO A BROKEN WIRE.REPAIRED BROKEN WIRE IN ACCORDANCE WITH STANDARD PRACTICES OPERATIONAL CHECK OK.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
3	EA	327	BULB (P/O: STK-9415)		1.25	3.75

Labor: \$275.00	Parts: \$3.75	Shipping: \$0.00	Item Subtotal: \$278.75
------------------------	----------------------	-------------------------	--------------------------------

Item: 98 - Discrepancy

Discrepancy	Hours	Subtotal
AIRSTAIR STEP TREAD NOT SECURED.	0.50	55.00

Corrective Action

GLUED UPPER STEP TREAD TO AIRSTAIR I.A.W. STANDARD PRACTICES.

Labor: \$55.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$55.00
-----------------------	----------------------	-------------------------	-------------------------------

Item: 99 - Discrepancy

Discrepancy	Hours	Subtotal
MULTIPLE SEATBELT AND NO SMOKING LIGHTS INOP.	4.75	522.50

Corrective Action

MULTIPLE SEATBELT AND NO SMOKING LIGHTS INOP. TROUBLE SHOT TO POOR GROUND ON R/H FWD SEATBELT/NO SMOKING SIGN.REPLACED A TOTAL OF 14 BULBS P/N 34-0050315-1 N/S/N IN VARIES SEATBELT/NO SMOKING SIGNS PER GII59B M/M CHAP 33-00.. OPS CHECK IS GOOD.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
6		34-0050315-01	LIGHT BULB (A9906-7) (P/O: TRN-10428) (Ship: 27.20)		50.00	300.00
3		34-0050315-01	LIGHT BULB (A9906-7) (P/O: TRN-10428)		50.00	150.00
5		34-0050315-01	LIGHT BULB (A9906-7) (P/O: STK-8931)		50.00	250.00
3		34-0050315-01	LIGHT BULB (A9906-7)		50.00	150.00

Labor: \$522.50	Parts: \$850.00	Shipping: \$27.20	Item Subtotal: \$1,399.70
------------------------	------------------------	--------------------------	----------------------------------

Item: 100 - Discrepancy

Discrepancy	Hours	Subtotal
COMBINED HYD SYSTEM REQUIRES BLEEDING.	1.00	110.00

Corrective Action

BLEMED AND SERVICED THE FLIGHT AND COMBINED HYDRAULIC SYSTEMS TO FULL.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
4	QT	SKYDROL, 500B, QT.	SKYDROL 500B QT (P/O: STK-8985)		34.00	136.00

Labor: \$110.00	Parts: \$136.00	Shipping: \$0.00	Item Subtotal: \$246.00
------------------------	------------------------	-------------------------	--------------------------------

Item: 101 - Discrepancy

Discrepancy	Hours	Subtotal
EMERGENCY GEAR BLOW DOWN BOTTLE REQUIRES SERVICE.	0.50	55.00

Corrective Action
 SERVICED EMERGENCY GEAR BLOW DOWN BOTTLE TO OPERATIONAL LIMITS PER M/M CHAPTER 12-00-00.

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1	EA	NITROGEN, HIGH	NITROGEN HIGH PRESSURE CHARGE		40.00	40.00

Labor: \$55.00	Parts: \$40.00	Shipping: \$0.00	Item Subtotal: \$95.00
-----------------------	-----------------------	-------------------------	-------------------------------

Item: 102 - Discrepancy

Discrepancy	Hours	Subtotal
R/H ALTERNATOR DOES NOT COME ONLINE.	8.00	880.00

Corrective Action
 R/H ALTERNATOR DOES NOT COME ONLINE. T/S TO FAULTY ALTERNATOR. REMOVED FAULTY ALTERNATOR P/N 28B135-126-A S/N 369. INSTALLED AN OVERHAULED UNIT P/N 28B135-126-A S/N 1226 SUPPLIED BY WORLD AERO SPACE CRS#P04R447M UNDER W/O#15451. R&R PER GIIB M/M 24-02-04. OPERATIONAL CHECKS ARE GOOD.

Notes:
 ES- T/S, SWAPPED SUPERVISORY PANELS

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1		28B135-126-A	ALTERNATOR		5,175.00	5,175.00

Labor: \$880.00	Parts: \$5,175.00	Shipping: \$0.00	Item Subtotal: \$6,055.00
------------------------	--------------------------	-------------------------	----------------------------------

Additional Charges							Subtotal
Pilot Services	Tire Disposal	EPA Charge	Oil Analysis	Shop Supplies	Fuel	Misc.	
0.00	0.00	0.00	0.00	637.03	0.00	0.00	\$637.03

Labor Summary	Total Labor:	\$81,145.70
Shop Labor: \$63,703.40	Total Parts:	\$15,631.19
Outside Repair: \$17,442.30	Total Shipping:	\$2,291.94
	Additional Charges:	\$637.03
	Tax:	\$0.00
	Amount Due:	\$99,705.86
	Deposit:	\$0.00
	Balance Due:	\$99,705.86

Important Information

Hyperion Air, Inc or Authorized Representative

Date